

Cable to Ground Rod

Mold Information:


- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Molds listed are for tapered ground rods. For threaded sectional rods, add suffix "S" after the ground rod number. i.e. 58S = 5/8" sectional ground rod.
- Molds with Price Key "**L**" and "**M**" SOLD WITH HANDLES.
- Handles for "**L**" and "**M**" Price Key Molds DO NOT INCLUDE Flint Igniters.
- If Handles not required, add suffix "-X" after the Mold Part No.
- Price Key is the **Bold Letter** in the Mold Part No.
- For mold Wear Plates, add suffix "WP" to the end of the Mold Part No. See page 266 for details.

Required Tools & Accessories:

- MH1 - Handle for "**B**" Price Key Molds
- MH2 - Handle for "**C**" Price Key Molds
- FLTIG - Flint Igniter when Price Key is "**L**" or "**M**"

Recommended Tools & Accessories:

- CCBRSH1 - Cable Cleaning Brush
- MCBRS1 - Mold Cleaning Brush

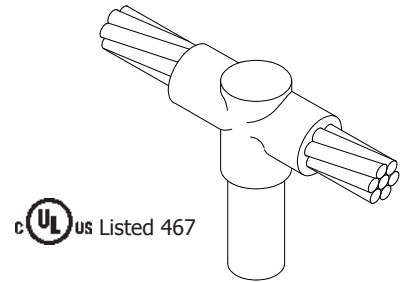

GO

(Horizontal Thru Cable to Top of Ground Rod)

GO Connection Type

Ground Rod Size	Cable Size	Mold Part No.	Weld Metal	
			UltraShot	NUWTUBE
1/2"	#6	GO-12F6 L	US32	NUWTUBE32
	#4	GO-12F4 L	US32	NUWTUBE32
	#2 Sol	GO-12F2 S	US90	NUWTUBE90
	#2	GO-12F2 B	US90	NUWTUBE90
	1/0	GO-12F1/ 0B	US90	NUWTUBE90
	2/0	GO-12F2/ 0B	US90	NUWTUBE90
	3/0	GO-12F3/ 0B	US115	NUWTUBE115
	4/0	GO-12F4/ 0B	US115	NUWTUBE115
	250 MCM	GO-12F25 CMB	US150	NUWTUBE150
300 MCM	GO-12F3 CMB	US200	NUWTUBE200	
5/8"	#6	GO-586 L	US32	NUWTUBE32
	#4	GO-584 L	US32	NUWTUBE32
	#2 Sol	GO-582 S	US90	NUWTUBE90
	#2	GO-582 B	US90	NUWTUBE90
	1/0	GO-581/ 0B	US90	NUWTUBE90
	2/0	GO-582/ 0B	US115	NUWTUBE115
	3/0	GO-583/ 0B	US115	NUWTUBE115
	4/0	GO-584/ 0B	US115	NUWTUBE115
	250 MCM	GO-5825 CMB	US150	NUWTUBE150
	300 MCM	GO-583 CMB	US200	NUWTUBE200
	350 MCM	GO-5835 CMB	US200	NUWTUBE200
	500 MCM	GO-585 CMB	US250	NUWTUBE250

GO Connection Type continued

Ground Rod Size	Cable Size	Mold Part No.	Weld Metal	
			UltraShot	NUWTUBE
3/4"	#6	GO-346 L	US45	NUWTUBE45
	#4	GO-344 M	US65	NUWTUBE65
	#2 Sol	GO-342 S	US90	NUWTUBE90
	#2	GO-342 B	US90	NUWTUBE90
	1/0	GO-341/ 0B	US115	NUWTUBE115
	2/0	GO-342/ 0B	US115	NUWTUBE115
	3/0	GO-343/ 0B	US115	NUWTUBE115
	4/0	GO-344/ 0B	US115	NUWTUBE115
	250 MCM	GO-3425 CMB	US150	NUWTUBE150
	300 MCM	GO-343 CMB	US200	NUWTUBE200
1"	350 MCM	GO-3435 CMB	US200	NUWTUBE200
	500 MCM	GO-345 CMB	US250	NUWTUBE250
	750 MCM	GO-3475 CMB	US400	2-NUWTUBE200
	1/0	GO-101/ 0B	US150	NUWTUBE150
	2/0	GO-102/ 0B	US150	NUWTUBE150
	3/0	GO-103/ 0B	US150	NUWTUBE150
	4/0	GO-104/ 0B	US150	NUWTUBE150
	250 MCM	GO-1025 CMB	US200	NUWTUBE200
	300 MCM	GO-103 CMB	US200	NUWTUBE200
	350 MCM	GO-1035 CMB	US200	NUWTUBE200
500 MCM	GO-105 CMB	US250	NUWTUBE250	
750 MCM	GO-1075 CMB	US400	2-NUWTUBE200	
1000 MCM	GO-101 MMC	US500	2-NUWTUBE250	

NOTES:

- Molds are for copper-clad steel ground rods.
- 1/2" molds are for full size ground rods.
- For welding to stainless steel, galvanized steel or solid copper ground rods, add letter "F" to ground rod size. For sectional ground rods, add letter "S" to ground rod size. See chart on page 326 for details.